

HAIYANGSHIYOU 937 ("HYSY937")



For Additional Information Please Contact:

COSL DRILLING

Marketing Department

P. O. Box 232, Beijing 101149, China, P.R.C

Phone: +86 010 84522511 Fax: +86 010 84522867

sh_cosldrillingmarket@cosl.com.cn


www.cosl.com.cn


| General Description | |
|---|---|
| Design/Generation | Marine Structure Consultants/CJ46-X100-D |
| Constructing Shipyard | Dalian shipbuilding Industry CO.,LTD |
| Year Enter Service/Significant Upgrades | 2009 |
| Classification | ABS&CCS |
| Flag | CHINA |
| Displacement | 15,675tons |
| Variable Deck | 3,500tons |
| Operating Water Depth | 300ft |
| Maximum Drilling Depth | 30,000ft |
| Accomodation | 120 |
| Drilling Equipment | |
| Top Drive | NOV HPS-04 750-AC-KT-RD, 1,150HP, 7,500psi |
| Draw works | NOV D3000AC with 3x1,3500HPAC |
| Derrick | NOV/NOV170'x35'x40'x18' TOP 1500000 Hook |
| Cantilever | 70ftx 20ft |
| Mud Pumps | NOV 14-P-220 x 3, 1,230HPeach, 7,500psi |
| Storage Capacities | |
| Fuel Oil | 3,868bbls |
| Liquid Mud | 4,553bbls |
| Base Oil | 1,264bbls |
| Brine | 1,264bbls |
| Drill Water | 22,379bbls |
| Portable Water | 3,698bbls |
| BOP & Subsea Equipment | |
| BOP Rams | 2 x CAMERON x 18-3/4 x 15,000psiWP Dual Ram |
| | BOPs |
| BOP Annular | Cameron x 18-3/4" x 10,000psiWP Annular |
| Diverter | VETCO/KFDJ |
| Other Information | |
| Cranes | 50ton x 3 |
| Heli-deck | Sikorski S61 N Helicopter |
| Containment System | zero discharge |

These specifications are intended for general reference purposes only. All equipment shall be operated and maintained at all times, in compliance with COSL DRILLING standard operating manuals, policies and procedures, and within its stated operational limits or continuous rated capacity, in order to assure maximum operational efficiency.



HAIYANGSHIYOU 937 ("HYSY937")

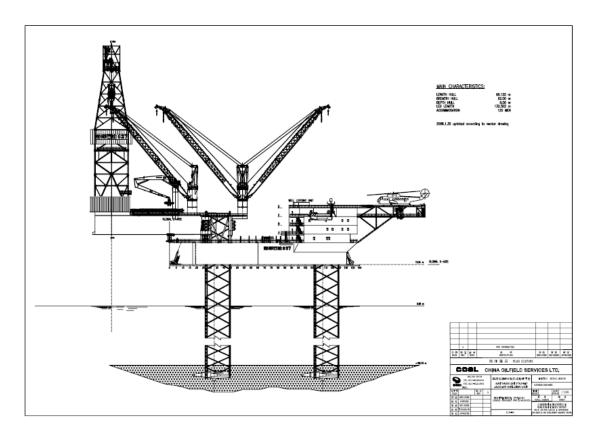

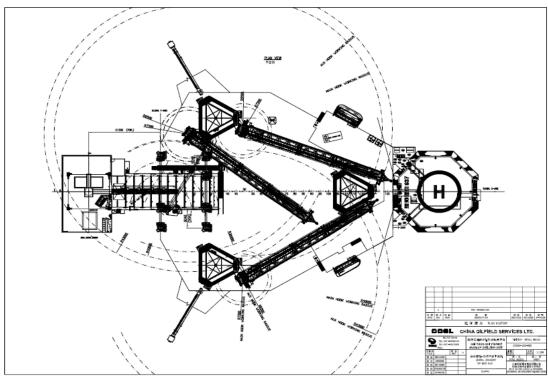

These specifications are intended for general reference purposes only. All equipment shall be operated and maintained at all times, in compliance with COSL DRILLING standard operating manuals, policies and procedures, and within its stated operational limits or continuous rated capacity, in order to assure maximum operational efficiency.